

ROC L-16 092461

FIRE EQUIPMENT SALES AND SERVICE CORPORATION

ROC L-67 092462

3107 W. VIRGINIA AVE. \* PHX, AZ 85008-1504 \* (602)433-2434 \* Fax (602)433-9626 2921 S. KISH AVE \* YUMA, AZ 85365 \* (928) 341-0025 \* Fax (928) 341-0356 SHOW LOW \* PINETOP \* LAKESIDE \* (928) 532-2292

10/29/2012

Jeff Akins
Blue Ridge Elementary School
1200 W. Mountain Bl.
Lake Side, Az. 85929

Phone: 928-369-3945

E-Mail: jakins@brusdk12.az/us

DNR#: SLM182

RE: Fire alarm repairs per system report dated 7/25/2012. Front Office.

American Fire Equipment Sales & Service would like to present you with the following proposal for the above referenced facility.

## **Deficiencies Noted**

- ▶ Upon arrival panel was in trouble due to bad smoke detector L2D051. Also there is a internal ground fault on the booster panel located in electrical rm. 392
- One heat detector in the library is left over from old system. Manual pull station in room 392 is blocked by shelf. Several horns and strobes do not function. Working strobes are not sychronized.
- ► All booster panel circuits Class B not A.
- Several booster panels have THHN wiring between control modules and booster panels, not in conduit.

## Scope of Work

- ► Replacement of bad smoke detector L2D051. Replacement of booster panel in electrical room 392.
- ▶ Demo old heat detector in library. Customer please relocate shelf so not to block pull station in room 392. Trouble shoot NAC circuit to determine why several horn/strobes are not functioning. Synchronize strobes.
- Schedule walk-thru to determine coverage needed in unprotected areas.
- Rewire sections between control modules and booster panels to run through conduit.

## Cost Summary

American Fire Equipment is pleased to provide and complete the above scope of work for the sum of:

Total Labor	\$1,700.00
Total Materials	\$683.02
Sub Total	\$2,383.02
Tax	\$63.52
Total Proposal	\$2,446.54